

Confidentiality level class 2:

This document intended for a restricted public only (Official Elinchrom agents, partners, suppliers, manufacturers or outsourcers). Any third party dissemination, distribution, copying or use of these documents, without prior permission, is strictly prohibited.

Date: 25.02.2016


Ref. : D.Job

Department: SAV

Red Led 10% always ON



Due to a defective Schottky diode, in some rare case, you can find this issue :

Even if the Ranger RX unit is OFF, the red Led 10% could stay ON.

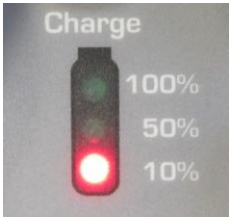


Diode to replace

We suggest to replace the Schottky diode D610 on the Keyboard (respect polarity)

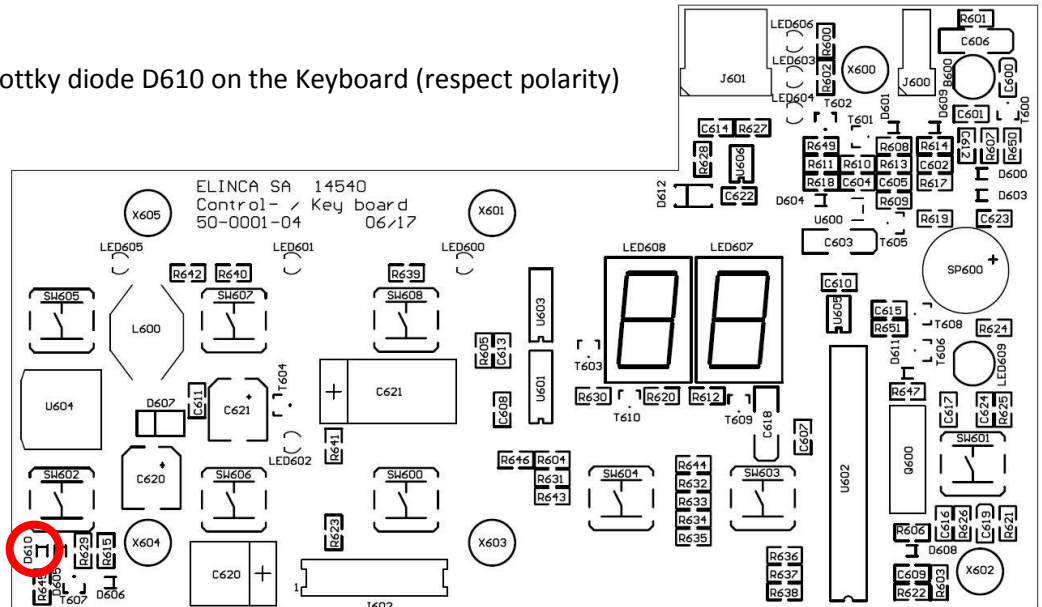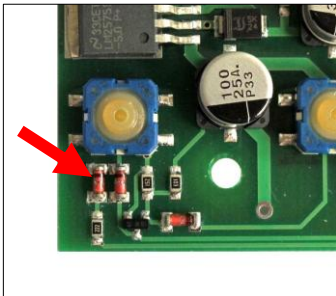

How to proceed to get a replacement

If you find this issue, please fill and send a warranty request form to obtain the replacement free of charge of the Diode Schottky 0.2A 30V TMMBAT42 **105.147**.

<p>105.147</p>	<p>Diode Schottky 0.2A 30V TMMBAT42</p>	
-----------------------	---	---